

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3403	H.C. Storm School	1054 - Exterior Face Brick			2020	Sent to Maintenance	Overall brick appears in fair to poor condition. Per Capital Project Plan - exterior brick scheduled for tuckpointing. A few issues with flashing that are causing minor damage. Efflorescence on a few faces. Water staining at gutters on east wall of	Shell	Exterior Vertical Enclosures	Exterior Walls	Exterior Wall Veneer	1-Must Do	Poor	1	\$195,000	Lump Sum	\$195,000
3441	H.C. Storm School	1082 - Ceilings, Gypsum		Staff	2020	Sent to Maintenance	Stains on ceiling Teacher Lounge Kitchenette Cost is to prime and paint.	Interiors	Interior Construction	Suspended Ceiling Construction	Suspended Plaster and Gypsum Board Ceilings	1-Must Do	Poor	419	\$1	Square Foot	\$419
3510	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Corridor	2020	Sent to Maintenance	Poor condition at Operable Walls. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		1-Must Do	Poor	0	\$6	Linear Foot	\$0
3511	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Conference	2020	Sent to Maintenance	Poor condition at Operable Walls. Conference 16 Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		1-Must Do	Poor	0	\$6	Linear Foot	\$0
3530	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Classrooms	2020	Sent to Maintenance	Missing in some locations, falling off partitions in some locations. Scuffed and scratched. D-1,2,3,4,5,6; 729 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		1-Must Do	Poor	0	\$6	Linear Foot	\$0
3532	H.C. Storm School	1137 - Interior Partitions, Demountable		Office/Conference	2020	Sent to Maintenance	Per Capital Projects Plan - demountable classroom partitions in poor condition. Replacement will need to include review of other finish (flooring, ceiling, painting, equipment) and building service (MEP) related items. D-0, Conference (655 SF)	Interiors	Interior Construction	Interior Partitions	Interior Demountable Partitions	1-Must Do	Poor	655	\$225	Square Foot	\$147,375

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3541	H.C. Storm School	1137 - Interior Partitions, Demountable		Classrooms	2020	Sent to Maintenance	Per Capital Projects Plan - demountable classroom partitions in poor condition. Replacement will need to include review of other finish (flooring, ceiling, painting, equipment) and building service (MEP) related items. D-1,2,3,4,5,6	Interiors	Interior Construction	Interior Partitions	Interior Demountable Partitions	1-Must Do	Poor	6983	\$225	Square Foot	\$1,571,175
3542	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal		Classrooms	2020	Sent to Maintenance	Classroom doors do not close within demountable partition. D-1,2,3,4,5,6; 6 doors Cost is to replace frame and wood door with hardware. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	1-Must Do	Poor	0	\$2,400	Each	\$0
3543	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal		Office	2020	Sent to Maintenance	Door does not close within demountable partition. Office D-0; 1 door Cost is to replace frame and wood door with hardware. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	1-Must Do	Poor	0	\$2,400	Each	\$0
5664	H.C. Storm School	1103 - Flooring, Ceramic Tile		Toilets	2020	Sent to Maintenance	Damage at transition from rubber to tile transition. B Wing toilet rooms Cost is to replace in kind	Interiors	Interior Finishes	Flooring	Tile Flooring	1-Must Do	Poor	4	\$30	Linear Foot	\$120
5665	H.C. Storm School	1129 - Fixed Equipment, Window Treatments-Manual	West Classrooms	Classroom	2020	Sent to Maintenance	Blind bent Classroom C-4	Equipment and Furnishings	Furnishings	Fixed Furnishings	Window Treatments	1-Must Do	Poor	12	\$90	Linear Foot	\$1,080
5670	H.C. Storm School	1137 - Interior Partitions, Demountable		Classrooms	2020	Sent to Maintenance	Per Capital Projects Plan - demountable classroom partitions in poor condition. Replacement will need to include review of other finish (flooring, ceiling, painting, equipment) and building service (MEP) related items. B-1,2,3,4,5,6	Interiors	Interior Construction	Interior Partitions	Interior Demountable Partitions	1-Must Do	Poor	7448	\$225	Square Foot	\$1,675,800

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
5671	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Classrooms	2020	Sent to Maintenance	Base is coming off the walls. B-1,2,3,4,5,6; 13,225 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		1-Must Do	Poor	0	\$6	Linear Foot	\$0
5675	H.C. Storm School	1052 - Slab on Grade		Toilet	2020	Sent to Maintenance	Cracking and chips in floor. Gym toilet room Cost is to replace with epoxy floor finish.	Substructure	Slabs-On-Grade	Standard Slabs-on-Grade		1-Must Do	Poor	300	\$20	Square Foot	\$6,000
5682	H.C. Storm School	1100 - Ceilings, Acoustical Suspended Systems		Office	2020	Sent to Maintenance	Ceiling stained and damaged. Office B-0; 653 SF Cost is to replace system in its entirety. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	1-Must Do	Poor	0	\$8	Square Foot	\$0
5684	H.C. Storm School	1137 - Interior Partitions, Demountable		Office	2020	Sent to Maintenance	Per Capital Projects Plan - demountable classroom partitions in poor condition. Replacement will need to include review of other finish (flooring, ceiling, painting, equipment) and building service (MEP) related items. Office B-0	Interiors	Interior Construction	Interior Partitions	Interior Demountable Partitions	1-Must Do	Poor	653	\$225	Square Foot	\$146,925
5698	H.C. Storm School	1057 - Exterior Entrance Doors, Hollow Metal			2020	Sent to Maintenance	Dented, nicked, scratched. Lintels rusted. Main entrance Cost is to replace system with aluminum entry system at both pairs of doors; lintel replacement.	Shell	Exterior Vertical Enclosures	Exterior Doors and Grilles	Exterior Entrance Doors	1-Must Do	Poor	1	\$17,640	Lump Sum	\$17,640
5708	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal	West Classrooms	Classrooms	2020	Sent to Maintenance	Classroom doors do not close within demountable partitions. C-1,2,3,4,5,6 Cost is to replace frame and wood door with hardware.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	1-Must Do	Poor	6	\$2,400	Each	\$14,400

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
5709	H.C. Storm School	1110 - Interior Doors, Swinging-Hollow Metal		Classrooms	2020	Sent to Maintenance	Classroom doors do not close. B-1,2,3,4,5,6; 6 doors Cost is to replace frame and wood door with hardware. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	1-Must Do	Poor	0	\$2,400	Each	\$0
5711	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Corridor	2020	Sent to Maintenance	Poor condition at metal operable walls; 20 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		1-Must Do	Poor	0	\$6	Linear Foot	\$0
5727	H.C. Storm School	1128 - Fixed Equipment, Casework		Kitchen	2020	Sent to Maintenance	Chipped and corners have been damaged.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	1-Must Do	Poor	24	\$800	Linear Foot	\$19,200
5728	H.C. Storm School	1087 - Flooring, VCT		Kitchen	2020	Sent to Maintenance	Stained and discolored. Cost is to replace with epoxy flooring.	Interiors	Interior Finishes	Flooring	Resilient Flooring	1-Must Do	Poor	335	\$20	Square Foot	\$6,700
5734	H.C. Storm School	1136 - Sitework, Pedestrian Pavement			2020	Sent to Maintenance	Cracks in pedestrian pavement, mainly outside classroom doors where it has been shoveled. Some is broken up and at different levels.	Sitework	Site Improvements	Pedestrian Plazas and Walkways	Pedestrian Pavement	1-Must Do	Poor	200	\$10	Square Foot	\$2,000
5735	H.C. Storm School	1134 - Sitework, Parking Lot Pavement			2020	Sent to Maintenance	large cracking in pavement. Cost is for full depth replacement with standard-duty asphalt paving.	Sitework	Site Improvements	Parking Lots	Parking Lot Pavement	1-Must Do	Poor	33885	\$6	Square Foot	\$203,310
6210	H.C. Storm School	1113 - HVAC, RTU			2020	Sent to Maintenance	Per Capital Project Plan - 4 RTU are in poor condition and scheduled replacement in 2023.	Services	Heating, Ventilation, and Air Conditioning (HVAC)	Ventilation	Outside Air	1-Must Do	Poor	1	\$145,000	Lump Sum	\$145,000
7944	H.C. Storm School	10170 - Interior Wall Finish, Paint		Kitchen	2020	Sent to Maintenance	SF indicated for room area to receive paint.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	1-Must Do	Poor	335	\$2	Square Foot	\$754
3405	H.C. Storm School	1066 - Exterior Face Brick	West Classrooms		2020	Sent to Maintenance	Overall brick appears in fair to good condition. Per Capital Project Plan - exterior brick scheduled for tuckpointing.	Shell	Exterior Vertical Enclosures	Exterior Walls	Exterior Wall Veneer	2-Should Do	Fair	1	\$55,000	Lump Sum	\$55,000
3407	H.C. Storm School	1055 - Exterior Windows, Operating			2020	Sent to Maintenance	Flashing has been added to windows because it looks like original flashing failed. In tact and in relatively good condition. Windows assumed to be original based on information provided. Cost is to replace windows.	Shell	Exterior Vertical Enclosures	Exterior Windows	Exterior Operating Windows	2-Should Do	Fair	650	\$100	Square Foot	\$65,000
3410	H.C. Storm School	1136 - Sitework, Pedestrian Pavement			2020	Sent to Maintenance	Cracks in pedestrian pavement, mainly outside classroom doors where it has been shoveled.	Sitework	Site Improvements	Pedestrian Plazas and Walkways	Pedestrian Pavement	2-Should Do	Fair	26000	\$10	Square Foot	\$260,000

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3413	H.C. Storm School	1061 - Exterior Ceilings			2020	Sent to Maintenance	Soffits generally in fair condition. Painting needed to patch or fix peeling paint. Cost is to prime and paint area.	Shell	Exterior Horizontal Enclosures	Overhead Exterior Enclosures	Exterior Ceilings	2-Should Do	Fair	100	\$1	Square Foot	\$100
3415	H.C. Storm School	1067 - Exterior Windows, Operating	West Classrooms		2020	Sent to Maintenance	Windows assumed to be original based on information provided. Cost is to replace window.	Shell	Exterior Vertical Enclosures	Exterior Windows	Exterior Operating Windows	2-Should Do	Fair	575	\$100	Square Foot	\$57,500
3424	H.C. Storm School	1064 - Exterior Louvers and	West Classrooms		2020	Sent to Maintenance	Damage to and painting needed for many of the vents.	Shell	Exterior Vertical Enclosures	Exterior Louvers and Vents		2-Should Do	Fair	600	\$40	Square Foot	\$24,000
3430	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Staff	2020	Sent to Maintenance	Mismatched tiles, in fair condition. A few bent and bowing. Grid is in good condition. Teacher's Lounge 504 Cost is for system replacement.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	419	\$7	Square Foot	\$2,724
3435	H.C. Storm School	1104 - Flooring, VCT		Teacher Lounge/Kitchenette	2020	Sent to Maintenance	Edge is chipped and broken going into teacher's lounge. Cost is to replace VCT with rubber.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	419	\$12	Square Foot	\$5,028
3437	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Staff	2020	Sent to Maintenance	Grid is painted different color than the rest of the grid in the lounge area. Tiles are bowing. Teacher Lounge Kitchenette Cost is for system replacement.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	419	\$7	Square Foot	\$2,724
3443	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal		Staff	2020	Sent to Maintenance	Minor rust at the bottom of door frame. Teacher's Lounge 504 Cost is for new HM frame.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	2-Should Do	Fair	2	\$450	Each	\$900
3448	H.C. Storm School	1092 - Flooring, Carpet		Staff	2020	Sent to Maintenance	Wear and tear; heavy traffic area. Minor stains. Work Room 13 Cost is to replace with carpet tile.	Interiors	Interior Finishes	Flooring	Carpeting	2-Should Do	Fair	452	\$7	Square Foot	\$2,938
3450	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Staff	2020	Sent to Maintenance	Some tiles are bowing and some are chipped. Grid is overall in good condition. Work Room 13 Cost is for system replacement.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	452	\$7	Square Foot	\$2,938
3451	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Staff	2020	Sent to Maintenance	In good condition. Holes from hung items are showing. Paint is in tact and no major issues. Work Room 13	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	2-Should Do	Fair	419	\$0	Square Foot	\$0
3453	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Staff	2020	Sent to Maintenance	Scuffed and scratched. Generally in tact. Work Room 13	Interiors	Interior Finishes	Wall Finishes		2-Should Do	Fair	150	\$6	Linear Foot	\$900

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3454	H.C. Storm School	1128 - Fixed Equipment, Casework		Staff	2020	Sent to Maintenance	Scuffed and scratched. Generally in tact. Work Room 13	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	2-Should Do	Fair	40	\$800	Linear Foot	\$32,000
3457	H.C. Storm School	1052 - Slab on Grade		Storage	2020	Sent to Maintenance	Paint finish of slab on grade is scuffed and scratched, chips in finish. Storage 8	Substructure	Slabs-On-Grade	Standard Slabs-on-Grade		2-Should Do	Fair	246	\$20	Square Foot	\$4,920
3459	H.C. Storm School	1100 - Ceilings, Acoustical Suspended Systems		Storage	2020	Sent to Maintenance	Stains and buckling of some tiles. Storage 8	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	246	\$8	Square Foot	\$1,845
3468	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal		Office	2020	Sent to Maintenance	Scatched heavily Office 14 Cost is to replace with wood door and new hardware.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	2-Should Do	Fair	1	\$1,950	Each	\$1,950
3472	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Office	2020	Sent to Maintenance	Overall fair condition, some tiles are bowing. General Office 14 Cost is for system replacement.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	402	\$7	Square Foot	\$2,613
3492	H.C. Storm School	1104 - Flooring, VCT		Cafeteria	2020	Sent to Maintenance	Overall, condition is fair. Minor scuffs and scratches. Dents in floor. Cost is to replace VCT with rubber.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	2386	\$12	Square Foot	\$28,632
3503	H.C. Storm School	1079 - Interior Doors, Coiling		Cafeteria	2020	Sent to Maintenance	Scatched, needs painting. Left in up position. Cost is for shutter overhead shutter replacement.	Interiors	Interior Construction	Interior Doors	Interior Coiling Doors	2-Should Do	Fair	1	\$2,000	Each	\$2,000
3507	H.C. Storm School	1087 - Flooring, VCT		Corridor	2020	Sent to Maintenance	Some dents, scratches and aging. Corridor 1, 572 SF Cost is to replace VCT with rubber. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$12	Square Foot	\$0
3508	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Corridor	2020	Sent to Maintenance	Generally in fair condition. Some tiles are buckling or stained. Corridor 1	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	572	\$7	Square Foot	\$3,718
3509	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Corridor	2020	Sent to Maintenance	Fair condition overall at CMU walls.	Interiors	Interior Finishes	Wall Finishes		2-Should Do	Fair	133	\$6	Linear Foot	\$798

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3513	H.C. Storm School	1087 - Flooring, VCT		Conference	2020	Sent to Maintenance	Cracks in room 16. Overall, fair quality. Conference 16, 17; 326 SF. Cost is to replace VCT with carpet tile. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$7	Square Foot	\$0
3519	H.C. Storm School	1110 - Interior Doors, Swinging-Hollow Metal		Conference	2020	Sent to Maintenance	Dents, scratches and bowing, but doors close. Conference 16,17; 2 doors Cost is to replace with wood doors and new hardware. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	2-Should Do	Fair	0	\$1,950	Each	\$0
3525	H.C. Storm School	1104 - Flooring, VCT		Corridor/Collaboration	2020	Sent to Maintenance	Scratched and scuffed. D Wing Corridor/Shared Space; 2,021 SF Cost is to replace VCT with rubber. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$12	Square Foot	\$0
3527	H.C. Storm School	1104 - Flooring, VCT		Classrooms	2020	Sent to Maintenance	Scratched and scuffed. D-1,2,3,4,5,6; 5,600 SF Cost is to replace VCT with rubber. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$12	Square Foot	\$0
3531	H.C. Storm School	1128 - Fixed Equipment, Casework		Classrooms	2020	Sent to Maintenance	D-1,2,3,4,5,6 Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	2-Should Do	Fair	0	\$800	Linear Foot	\$0

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3536	H.C. Storm School	1093 - Interior Specialties, Toilet Compartments		Toilets	2020	Sent to Maintenance	Some dents and scratches. D Wing Restrooms Cost is to replace with solid phenolic (SPCP) partitions.	Interiors	Interior Construction	Interior Specialties	Toilet, Bath, and Laundry Accessories	2-Should Do	Fair	8	\$1,800	Each	\$14,400
3544	H.C. Storm School	1104 - Flooring, VCT		Office	2020	Sent to Maintenance	Some scratches. D Wing Office D-0; 367 SF Cost is to replace VCT with rubber. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$12	Square Foot	\$0
3546	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Office	2020	Sent to Maintenance	Some scratches and dents. Visible portion of base is in tact and attached to wall. D Wing Office D-0; 85 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		2-Should Do	Fair	0	\$6	Linear Foot	\$0
3547	H.C. Storm School	1094 - Interior Partitions, Fixed-GWB		Corridor	2020	Sent to Maintenance	Scuffed and scratched. Dents in wall that have been painted are visible. No corner guards and large concentration of dents at outside corners. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	2-Should Do	Fair	0	\$15	Square Foot	\$0
3549	H.C. Storm School	1094 - Interior Partitions, Fixed-GWB		Corridor	2020	Sent to Maintenance	Scuffed and scratched. Dents in wall that have been painted are visible. No corner guards and large concentration of dents at outside corners.	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	2-Should Do	Fair	100	\$15	Square Foot	\$1,500
3552	H.C. Storm School	1129 - Fixed Equipment, Window Treatments-Manual		Classrooms	2020	Sent to Maintenance	Blinds in tact appear to be in fair condition. D-1,2,3,4,5,6; 54 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Window Treatments	2-Should Do	Fair	0	\$90	Linear Foot	\$0
3558	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		LRC	2020	Sent to Maintenance	Some scratches and scuffs	Interiors	Interior Finishes	Wall Finishes		2-Should Do	Fair	350	\$6	Linear Foot	\$2,100

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3564	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Storage	2020	Sent to Maintenance	Scratches and bowing Storage 7 Cost is for system replacement	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	332	\$7	Square Foot	\$2,158
3565	H.C. Storm School	1087 - Flooring, VCT		Storage	2020	Sent to Maintenance	Scratches, fair condition. Storage 7 Cost is to replace in kind.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	332	\$7	Square Foot	\$2,324
3566	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Storage	2020	Sent to Maintenance	Scratches/scuffs present Storage 7	Interiors	Interior Finishes	Wall Finishes		2-Should Do	Fair	80	\$6	Linear Foot	\$480
4088	H.C. Storm School	1087 - Flooring, VCT	West Classrooms	Classrooms	2020	Sent to Maintenance	In tact. Scratches and general wear and tear. C-1,2,3,4,5,6,7,8 Cost is to replace VCT with rubber.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	7638	\$12	Square Foot	\$91,656
4098	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base	West Classrooms	Classrooms	2020	Sent to Maintenance	In fair condition, coming off operable walls at entries. C-1,2,3,4,5,6,7,8	Interiors	Interior Finishes	Wall Finishes		2-Should Do	Fair	15376	\$6	Linear Foot	\$92,256
5660	H.C. Storm School	1104 - Flooring, VCT		Classrooms	2020	Sent to Maintenance	Flooring is fair, some damage at transitions. Regular wear, tear and scuffs. B-1, 2, 3 4, 5, 6; 5,042 SF Cost is to replace VCT with rubber. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$12	Square Foot	\$0
5662	H.C. Storm School	1128 - Fixed Equipment, Casework		Classrooms	2020	Sent to Maintenance	casework won't shut in some locations, fair overall B-1,2,3,4,5,6; 150 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	2-Should Do	Fair	0	\$800	Linear Foot	\$0
5666	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU	West Classrooms	Toilets	2020	Sent to Maintenance	Holes in wall at Girl's restroom C-Wing toilets	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	2-Should Do	Fair	1	\$0	Square Foot	\$0
5667	H.C. Storm School	1100 - Ceilings, Acoustical Suspended Systems	West Classrooms	Office	2020	Sent to Maintenance	Ceiling stained. LRC Office 18	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	236	\$8	Square Foot	\$1,770
5669	H.C. Storm School	1128 - Fixed Equipment, Casework	West Classrooms	Office	2020	Sent to Maintenance	Edges of casework damaged. LRC Office 18	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	2-Should Do	Fair	12	\$800	Linear Foot	\$9,600

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
5674	H.C. Storm School	1128 - Fixed Equipment, Casework		Conference	2020	Sent to Maintenance	Missing Handle on casework door B-wing conference; 10 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	2-Should Do	Fair	0	\$800	Linear Foot	\$0
5676	H.C. Storm School	1087 - Flooring, VCT		Conference	2020	Sent to Maintenance	B-Wing Conference Room; 90 SF Cost is to replace VCT with carpet tile. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$7	Square Foot	\$0
5677	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Conference	2020	Sent to Maintenance	Stains on ceiling. B-Wing conference; 90 SF Cost is for system replacement. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	0	\$8	Square Foot	\$0
5679	H.C. Storm School	1087 - Flooring, VCT		Corridor/Collaboration	2020	Sent to Maintenance	B-Wing Collab Space Cost is to replace VCT with rubber.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	1250	\$12	Square Foot	\$15,000
5683	H.C. Storm School	1087 - Flooring, VCT		Office	2020	Sent to Maintenance	scuffs and wear and tear Office B-0; 653 SF Cost is to replace VCT with carpet tile. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	0	\$7	Square Foot	\$0
5687	H.C. Storm School	1087 - Flooring, VCT		Classrooms	2020	Sent to Maintenance	Special Ed room 2 Cost is to replace VCT with rubber.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	1035	\$12	Square Foot	\$12,420
5691	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal		Classroom	2020	Sent to Maintenance	Frame is scratched. Special Ed 2	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	2-Should Do	Fair	1	\$450	Each	\$450
5692	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Classroom	2020	Sent to Maintenance	Music Room 3 Cost is for system replacement.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	1050	\$7	Square Foot	\$6,825
5695	H.C. Storm School	1087 - Flooring, VCT		Classroom	2020	Sent to Maintenance	Music Room 3 Cost is to replace VCT with carpet tile.	Interiors	Interior Finishes	Flooring	Resilient Flooring	2-Should Do	Fair	1050	\$7	Square Foot	\$6,825

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
5696	H.C. Storm School	1128 - Fixed Equipment, Casework		Classroom	2020	Sent to Maintenance	Top bending; cost is to replace countertop in kind. Music Room 3	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	2-Should Do	Fair	13	\$80	Linear Foot	\$1,040
5699	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Toilet	2020	Sent to Maintenance	Gym toilet room Cost is to replace system.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	2-Should Do	Fair	300	\$7	Square Foot	\$1,950
5700	H.C. Storm School	1093 - Interior Specialties, Toilet Compartments		Toilet	2020	Sent to Maintenance	Gym toilet room Cost is to replace with solid phenolic (SPCP) partitions.	Interiors	Interior Construction	Interior Specialties	Toilet, Bath, and Laundry Accessories	2-Should Do	Fair	2	\$1,800	Each	\$3,600
5702	H.C. Storm School	1127 - Plumbing, Plumbing Fixtures		Toilet	2020	Sent to Maintenance	Gym toilet room Cost is for paired toilet and lavatory, 2 each	Services	Plumbing	Domestic Water Distribution	Plumbing Fixtures	2-Should Do	Fair	2	\$4,500	Each	\$9,000
5703	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Gym	2020	Sent to Maintenance	Walls scuffed and scratched.	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	2-Should Do	Fair	6136	\$0	Square Foot	\$0
5726	H.C. Storm School	2047 - Casework, Cubbies		Corridor	2020	Sent to Maintenance	Cubbies generally in fair condition; some components have been broken off.	Interiors	Interior Finishes	Interior Fabrications		2-Should Do	Fair	286	\$175	Each	\$50,050
5730	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Toilets	2020	Sent to Maintenance	corners are scuffed and chipped. Needs new paint. C Wing toilet rooms	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	2-Should Do	Fair	8	\$0	Linear Foot	\$0
6208	H.C. Storm School	1062 - Roofing, Low Slope			2019	Sent to Maintenance	Built-up Roof (BUR) with gravel. Upon inspection found roof membrane to be in fair condition and performing as designed. Deficiencies found during this inspection were repaired while on site. Periodic visual roof inspections & routine maintenance can increase the long term service life of this roof assembly.	Shell	Exterior Horizontal Enclosures	Roofing	Low-Slope Roofing	2-Should Do	Fair	43428	\$30	Square Foot	\$1,302,840
6209	H.C. Storm School	1072 - Roofing, Low Slope - 1989	West Classrooms		2019	Sent to Maintenance	Built-up Roof (BUR) with gravel. Upon inspection found roof membrane to be in fair condition and performing as designed. Deficiencies found during this inspection were repaired while on site. Periodic visual roof inspections & routine maintenance can increase the long term service life of this roof assembly.	Shell	Exterior Horizontal Enclosures	Roofing	Low-Slope Roofing	2-Should Do	Fair	13817	\$30	Square Foot	\$414,510

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
7938	H.C. Storm School	10170 - Interior Wall Finish, Paint		Classrooms	2020	Sent to Maintenance	SF indicated for area of room to be painted. D-1,2,3,4,5,6; 5,600 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7939	H.C. Storm School	10170 - Interior Wall Finish, Paint		Classrooms	2020	Sent to Maintenance	SF indicated for area of room where walls are to be painted. B-1, 2, 3 4, 5, 6; 5,042 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7940	H.C. Storm School	10170 - Interior Wall Finish, Paint	West Classrooms	Classrooms	2020	Sent to Maintenance	SF indicated for area of rooms that are to be painted C-1,2,3,4,5,6,7,8	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	7638	\$2	Square Foot	\$17,186
7941	H.C. Storm School	10169 - Interior Wall Finish, Paint		Conference	2020	Sent to Maintenance	90 SF indicated for room area to receive paint. B-Wing Conference Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7943	H.C. Storm School	10170 - Interior Wall Finish, Paint		Conference	2020	Sent to Maintenance	326 SF indicated for room area to receive paint. Conference 16, 17 Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7947	H.C. Storm School	10169 - Interior Wall Finish, Paint		Staff	2020	Sent to Maintenance	SF indicated for room area to receive paint. Teacher Lounge Kitchenette	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	419	\$2	Square Foot	\$943
7948	H.C. Storm School	10169 - Interior Wall Finish, Paint		Corridor	2020	Sent to Maintenance	SF indicated for room area to receive paint. Corridor 1; 572 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
7949	H.C. Storm School	10170 - Interior Wall Finish, Paint		Office	2020	Sent to Maintenance	SF indicated for room area to receive paint. Office B-0; 653 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7950	H.C. Storm School	10169 - Interior Wall Finish, Paint		Classroom	2020	Sent to Maintenance	SF indicated for room area to receive paint. Special Ed 2	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	1035	\$2	Square Foot	\$2,329
7951	H.C. Storm School	10169 - Interior Wall Finish, Paint		Classroom	2020	Sent to Maintenance	SF indicated for room area to receive paint. Music Room 3	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	1050	\$2	Square Foot	\$2,363
7952	H.C. Storm School	10170 - Interior Wall Finish, Paint		Corridor/Collaboration	2020	Sent to Maintenance	SF indicated for room area to receive paint. B-Wing Collab Space; 1,250 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7953	H.C. Storm School	10169 - Interior Wall Finish, Paint		Corridor/Collaboration	2020	Sent to Maintenance	SF indicated for room area to receive paint. D Wing Corridor/Shared Space; 2,021 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0
7954	H.C. Storm School	10169 - Interior Wall Finish, Paint		Cafeteria	2020	Sent to Maintenance	SF indicated for room area to receive paint.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	2386	\$2	Square Foot	\$5,369
7956	H.C. Storm School	10170 - Interior Wall Finish, Paint		Classrooms	2020	Sent to Maintenance	SF indicated for room area to receive paint. B-1, 2, 3 4, 5, 6; 5,042 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	2-Should Do	Fair	0	\$2	Square Foot	\$0

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost	
7961	H.C. Storm School	2144 - Sitework, Playground Equipment (NW)			2018	Sent to Maintenance	Per 2018 Playground Inspection Report - two playgrounds on their property. The northwest playground is located at the back of the school and consists of a composite play structures, a freestanding climber, and parallel bars. The surfacing is engineered wood fiber mulch. Deficiencies consist mostly of missing, loose, and incorrect hardware. The older Miracle structure also has worn and cracking coating of decks and peeling finish on post caps. Drainage appears to be a problem as the mulch is soggy and decomposed at the surface. The mulch surface is elevated around the Burke structure. Cost is to replace equipment and loose fill surfacing.	Sitework	Site Improvements	Athletic, Recreational, and Playfield Areas			2-Should Do	Fair	1	\$185,000	Lump Sum	\$185,000
7962	H.C. Storm School	2145 - Sitework, Playground Equipment (SE)			2018	Sent to Maintenance	Per 2018 Playground Inspection Report - two playgrounds on their property. The southeast playground is located near the front drop off of the school and consists of two composite play structures, a spinner and monkey bars. The surfacing is engineered wood fiber mulch. Deficiencies consist mostly of missing, loose, and incorrect hardware. The older Miracle structure also has worn and cracking coating of decks and peeling finish on post caps. Drainage appears to be a problem as the mulch is soggy and decomposed at the surface. The mulch surface is elevated around the Burke structure. Cost is to replace equipment and loose fill surfacing.	Sitework	Site Improvements	Athletic, Recreational, and Playfield Areas			2-Should Do	Fair	1	\$185,000	Lump Sum	\$185,000
6211	H.C. Storm School	1112 - HVAC, Boiler Plant			2020	Sent to Maintenance	Per Capital Project Plan - 3 boilers scheduled for replacement in 2028.	Services	Heating, Ventilation, and Air Conditioning (HVAC)	Heating Systems	Heat Generation	3-Like To Do	Good	1	\$250,000	Lump Sum	\$250,000	
6212	H.C. Storm School	1119 - HVAC, Distribution-Hydronic			2020	Sent to Maintenance	Per Capital Project Plan - 9 pumps scheduled for replacement in 2028.	Services	Heating, Ventilation, and Air Conditioning (HVAC)	Facility HVAC Distribution Systems	Facility Hydronic Distribution	3-Like To Do	Good	1	\$40,000	Lump Sum	\$40,000	
3412	H.C. Storm School	1057 - Exterior Entrance Doors, Hollow Metal			2020	Sent to Maintenance	Doors and frames in good condition.	Shell	Exterior Vertical Enclosures	Exterior Doors and Grilles	Exterior Entrance Doors	4-Future	Good	23	\$2,600	Each	\$59,800	

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3417	H.C. Storm School	1057 - Exterior Entrance Doors, Hollow Metal	West Classrooms		2020	Sent to Maintenance	Doors and frames in good condition.	Shell	Exterior Vertical Enclosures	Exterior Doors and Grilles	Exterior Entrance Doors	4-Future	Good	10	\$2,600	Each	\$26,000
3419	H.C. Storm School	1071 - Exterior Ceilings	West Classrooms		2020	Sent to Maintenance	Overall, quality is good. Minor painting and touch ups needed. Cost is for painting.	Shell	Exterior Horizontal Enclosures	Overhead Exterior Enclosures	Exterior Ceilings	4-Future	Good	0	\$1	Square Foot	\$0
3421	H.C. Storm School	1073 - Exterior Wall, Parapets	West Classrooms		2020	Sent to Maintenance	Parapets appear to be in good condition. Coping in tact and minimal water damage and damage to brick. Per Capital Project Plan - exterior brick scheduled for tuckpointing;	Shell	Exterior Vertical Enclosures	Exterior Walls	Parapets	4-Future	Good	0	\$0	Linear Foot	\$0
3429	H.C. Storm School	1138 - Interiors, Flooring-LVT		Staff	2020	Sent to Maintenance	Flooring in good condition. A few minor scuffs and scratches. Teacher's Lounge 504 Cost is to replace VCT with rubber.	Interiors	Interior Finishes	Flooring	Resilient Flooring	4-Future	Good	419	\$12	Square Foot	\$5,028
3431	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Staff	2020	Sent to Maintenance	Base condition is overall good. A few paint stains from wall painting. Teacher's Lounge 504	Interiors	Interior Finishes	Wall Finishes		4-Future	Good	0	\$6	Linear Foot	\$0
3438	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Staff	2020	Sent to Maintenance	In good condition. Teacher Lounge/Kitchenette	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	419	\$0	Square Foot	\$0
3439	H.C. Storm School	1128 - Fixed Equipment, Casework		Staff	2020	Sent to Maintenance	Overall good condition. A few shelves are bowing due to weight of items.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	4-Future	Good	8	\$800	Linear Foot	\$6,400
3455	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal			2020	Sent to Maintenance	No visible issues; overall good condition. Work Room 13 Cost is to replace with wood door and new hardware.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	4-Future	Good	8	\$1,950	Each	\$15,600
3458	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Storage	2020	Sent to Maintenance	Paint is in tact and not scratched. Storage 8	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	246	\$0	Square Foot	\$0
3465	H.C. Storm School	1095 - Interior Doors, Swinging-Hollow Metal		Storage	2020	Sent to Maintenance	Scratching on door and frame. Storage 8	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	4-Future	Good	1	\$1,950	Each	\$1,950
3470	H.C. Storm School	1138 - Interiors, Flooring-LVT		Office	2020	Sent to Maintenance	In good condition, minor scuffs. Principal's Office 14	Interiors	Interior Finishes	Flooring	Resilient Flooring	4-Future	Good	402	\$10	Square Foot	\$4,020
3473	H.C. Storm School	1076 - Interior Partitions, Fixed-CMU		Office	2020	Sent to Maintenance	Paint is good; CMU condition is good.	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	402	\$0	Square Foot	\$0
3474	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Office	2020	Sent to Maintenance	Minor scuffs and scratches. General Office 14	Interiors	Interior Finishes	Wall Finishes		4-Future	Good	0	\$6	Linear Foot	\$0
3475	H.C. Storm School	1128 - Fixed Equipment, Casework		Office	2020	Sent to Maintenance	Overall good condition. General Office 14	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	4-Future	Good	14	\$800	Linear Foot	\$11,200

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3477	H.C. Storm School	1111 - Interior Windows, Fixed		Office	2020	Sent to Maintenance	Overall good condition. 15 General Office 14	Interiors	Interior Construction	Interior Windows	Interior Fixed Windows	4-Future	Good	120	\$45	Square Foot	\$5,400
3478	H.C. Storm School	1097 - Interior Doors, Swinging-Wood		Office	2020	Sent to Maintenance	Overall good condition. General Office 14	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	4-Future	Good	1	\$1,950	Each	\$1,950
3479	H.C. Storm School	1110 - Interior Doors, Swinging-Hollow Metal		Office	2020	Sent to Maintenance	Overall good condition. Principal office 6 Cost is to replace with wood doors and new hardware.	Interiors	Interior Construction	Interior Doors	Interior Swinging Doors	4-Future	Good	2	\$1,950	Each	\$3,900
3493	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Cafeteria	2020	Sent to Maintenance	Minor scratches and paint scuffs.	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	2386	\$0	Square Foot	\$0
3495	H.C. Storm School	1100 - Ceilings, Acoustical Suspended Systems		Cafeteria	2020	Sent to Maintenance	Minor scratches and paint scuffs. Less than 25% is damaged.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	2386	\$8	Square Foot	\$17,895
3496	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Cafeteria	2020	Sent to Maintenance	Minor scratches.	Interiors	Interior Finishes	Wall Finishes		4-Future	Good	0	\$6	Linear Foot	\$0
3499	H.C. Storm School	1141 - Equipment, In-Wall Cafeteria Tables		Cafeteria	2020	Sent to Maintenance	Good condition. All work.	Equipment and Furnishings	Equipment	Institutional Equipment		4-Future	Good	6	\$0	Each	\$0
3501	H.C. Storm School	1089 - Interior Stair Finishes, Resilient		Cafeteria	2020	Sent to Maintenance	Steps to Stage - in good condition.	Interiors	Interior Finishes	Stair Finishes	Resilient Stair Finish	4-Future	Good	211	\$12	Square Foot	\$2,532
3515	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Conference	2020	Sent to Maintenance	Good condition. Conference 16, 17	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	326	\$8	Square Foot	\$2,445
3521	H.C. Storm School	1111 - Interior Windows, Fixed		Conference	2020	Sent to Maintenance	Conference 16 & 17; 2 windows. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Interior Windows	Interior Fixed Windows	4-Future	Good	0	\$45	Square Foot	\$0
3522	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Corridor/Collaboration	2020	Sent to Maintenance	D Wing Corridor/Shared Space	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	2021	\$8	Square Foot	\$15,158
3528	H.C. Storm School	1100 - Ceilings, Acoustical Suspended Systems		Classrooms	2020	Sent to Maintenance	In good condition. D-1,2,3,4,5,6; 5,600 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	0	\$8	Square Foot	\$0
3535	H.C. Storm School	1085 - Flooring, Ceramic Tile		Toilets	2020	Sent to Maintenance	D Wing Restrooms	Interiors	Interior Finishes	Flooring	Tile Flooring	4-Future	Good	430	\$30	Square Foot	\$12,900
3537	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Toilets	2020	Sent to Maintenance	Some dents and scratches but otherwise good condition. D Wing Restrooms	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	428	\$8	Square Foot	\$3,210

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3538	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Toilets	2020	Sent to Maintenance	D Wing Restrooms	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	0	\$0	Square Foot	\$0
3539	H.C. Storm School	1127 - Plumbing, Plumbing Fixtures		Toilets	2014	Sent to Maintenance	5 toilets and 2 sinks at girls restroom; 2 toilets, 3 urinals and 2 sinks at boys restroom D Wing Restrooms Per 2014 H/LS Report - There are an adequate number of fixtures in the building to meet the requirements of the Illinois Plumbing Code. The plumbing fixtures range from fair to new condition and appear to be operating correctly. The lavatories, urinals, and water closets are wall mounted. Cost is for water closet replacement.	Services	Plumbing	Domestic Water Distribution	Plumbing Fixtures	4-Future	Good	10	\$2,000	Each	\$20,000
3540	H.C. Storm School	1082 - Ceilings, Gypsum		Toilets	2020	Sent to Maintenance	minor portion at entry to restrooms; 80 SF D Wing Restrooms Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Suspended Plaster and Gypsum Board Ceilings	4-Future	Good	0	\$12	Square Foot	\$0
3545	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Office	2020	Sent to Maintenance	D Wing Office D-0	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	367	\$8	Square Foot	\$2,753
3554	H.C. Storm School	1092 - Flooring, Carpet		LRC	2020	Sent to Maintenance	Good condition. No major stains.	Interiors	Interior Finishes	Flooring	Carpeting	4-Future	Good	5640	\$7	Square Foot	\$36,660
3555	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		LRC	2020	Sent to Maintenance	Good condition overall.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	5640	\$8	Square Foot	\$42,300
3556	H.C. Storm School	1082 - Ceilings, Gypsum		LRC	2020	Sent to Maintenance	Perimeter of LRC, generally in good condition. Cost is for paint refresh	Interiors	Interior Construction	Suspended Ceiling Construction	Suspended Plaster and Gypsum Board Ceilings	4-Future	Good	1000	\$1	Square Foot	\$1,000
3557	H.C. Storm School	1076 - Interior Partitions, Fixed-CMU		LRC	2020	Sent to Maintenance	paint in tact; column gyp and paint in tact.	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	5640	\$0	Square Foot	\$0
3559	H.C. Storm School	1092 - Flooring, Carpet		Conference	2020	Sent to Maintenance	D-Conference 4, 3, 2; 3,148 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Flooring	Carpeting	4-Future	Good	0	\$7	Square Foot	\$0

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
3560	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Conference	2020	Sent to Maintenance	B-Conference 4, 3, 2; 3,127 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	0	\$8	Square Foot	\$0
3561	H.C. Storm School	1142 - Interior Wall Finishes, Wall Base		Conference	2020	Sent to Maintenance	B-Conference 4, 3, 2; 352 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes		4-Future	Good	0	\$6	Linear Foot	\$0
3563	H.C. Storm School	1077 - Interior Windows, Fixed		Conference	2020	Sent to Maintenance	Rooms 9, 10, 11	Interiors	Interior Construction	Interior Windows	Interior Fixed Windows	4-Future	Good	40	\$45	Square Foot	\$1,800
4081	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems	West Classrooms	Classrooms	2020	Sent to Maintenance	Fairly clean overall and in good condition. C-1,2,3,4,5,6,7,8	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	7638	\$8	Square Foot	\$57,285
4083	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Classrooms	2020	Sent to Maintenance	Fairly clean overall and in good condition. B-1,2,3,4,5,6; 5,042 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	0	\$8	Square Foot	\$0
4096	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU	West Classrooms	Classrooms	2020	Sent to Maintenance	In good condition. Paint in good condition. Few minor marks and scratches. C-1,2,3,4,5,6,7,8	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	0	\$0	Square Foot	\$0
5668	H.C. Storm School	1087 - Flooring, VCT	West Classrooms	Office	2020	Sent to Maintenance	LRC Office 18 Cost is to replace VCT with carpet tile.	Interiors	Interior Finishes	Flooring	Resilient Flooring	4-Future	Good	236	\$7	Square Foot	\$1,534
5672	H.C. Storm School	1129 - Fixed Equipment, Window Treatments-Manual		Classrooms	2020	Sent to Maintenance	all blinds work. B-1,2,3,4,5,6 Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Window Treatments	4-Future	Good	0	\$90	Linear Foot	\$0

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
5673	H.C. Storm School	1127 - Plumbing, Plumbing Fixtures		Classrooms	2014	Sent to Maintenance	B-1,2,3,4,5,6; 5 total Per 2014 H/LS Report - There are an adequate number of fixtures in the building to meet the requirements of the Illinois Plumbing Code. The plumbing fixtures range from fair to new condition and appear to be operating correctly. The lavatories, urinals, and water closets are wall mounted. Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Services	Plumbing	Domestic Water Distribution	Plumbing Fixtures	4-Future	Good	0	\$2,500	Each	\$0
5678	H.C. Storm School	1139 - Roof Windows and Skylights		Corridor/Collaboration	2020	Sent to Maintenance	B-Wing Collab Space Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Shell	Exterior Horizontal Enclosures	Horizontal Openings	Roof Windows and Skylights	4-Future	Good	0	\$200	Square Foot	\$0
5680	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Corridor/Collaboration	2020	Sent to Maintenance	B-Wing Collab Space	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	1250	\$8	Square Foot	\$9,375
5685	H.C. Storm School	1081 - Ceilings, Acoustical Suspended Systems		Classroom	2020	Sent to Maintenance	Special Ed 2	Interiors	Interior Construction	Suspended Ceiling Construction	Acoustical Suspended Ceilings	4-Future	Good	1035	\$8	Square Foot	\$7,763
5686	H.C. Storm School	1096 - Interior Partitions, Fixed-CMU		Classroom	2020	Sent to Maintenance	Special Ed 2	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	1035	\$0	Square Foot	\$0
5688	H.C. Storm School	1082 - Ceilings, Gypsum		Classroom	2020	Sent to Maintenance	Gyp soffits - in good condition. Special Ed 2 Cost is for paint refresh	Interiors	Interior Construction	Suspended Ceiling Construction	Suspended Plaster and Gypsum Board Ceilings	4-Future	Good	1035	\$1	Square Foot	\$1,035
5689	H.C. Storm School	1129 - Fixed Equipment, Window Treatments-Manual		Classroom	2020	Sent to Maintenance	Special Ed 2	Equipment and Furnishings	Furnishings	Fixed Furnishings	Window Treatments	4-Future	Good	0	\$90	Linear Foot	\$0
5690	H.C. Storm School	1128 - Fixed Equipment, Casework		Classroom	2020	Sent to Maintenance	Special Ed 2	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	4-Future	Good	0	\$800	Linear Foot	\$0
5693	H.C. Storm School	1076 - Interior Partitions, Fixed-CMU		Classroom	2020	Sent to Maintenance	Music Room 3	Interiors	Interior Construction	Interior Partitions	Interior Fixed Partitions	4-Future	Good	1050	\$0	Square Foot	\$0
5694	H.C. Storm School	1082 - Ceilings, Gypsum		Classroom	2020	Sent to Maintenance	Gyp Soffits Music Room 3 Cost is for paint refresh	Interiors	Interior Construction	Suspended Ceiling Construction	Suspended Plaster and Gypsum Board Ceilings	4-Future	Good	1050	\$1	Square Foot	\$1,050

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost
5697	H.C. Storm School	1129 - Fixed Equipment, Window Treatments-Manual		Classroom	2020	Sent to Maintenance	Music Room 3	Equipment and Furnishings	Furnishings	Fixed Furnishings	Window Treatments	4-Future	Good	0	\$90	Linear Foot	\$0
5704	H.C. Storm School	1087 - Flooring, VCT		Gym	2020	Sent to Maintenance	regular wear and tear. Cost is to replace with athletic flooring.	Interiors	Interior Finishes	Flooring	Resilient Flooring	4-Future	Good	6136	\$15	Square Foot	\$92,040
5706	H.C. Storm School	2048 - Bleachers		Gym	2020	Sent to Maintenance	fair to good condition; 6,136 SF Cost is per seat to replace.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Other Fixed Furnishings	4-Future	Good	0	\$450	Each	\$0
5710	H.C. Storm School	1128 - Fixed Equipment, Casework		Conference	2020	Sent to Maintenance	looks recently renovated. Conference 16, 17; 10 LF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	4-Future	Good	0	\$800	Linear Foot	\$0
5712	H.C. Storm School	1082 - Ceilings, Gypsum		Corridor/Collaboration	2020	Sent to Maintenance	Gyp soffit outside room 02 (D Wing Corridor/Shared Space); 64 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Construction	Suspended Ceiling Construction	Suspended Plaster and Gypsum Board Ceilings	4-Future	Good	0	\$12	Square Foot	\$0
5729	H.C. Storm School	1124 - Plumbing, Plumbing Fixtures		Toilets	2014	Sent to Maintenance	C Wing toilet rooms Per 2014 H/LS Report - There are an adequate number of fixtures in the building to meet the requirements of the Illinois Plumbing Code. The plumbing fixtures range from fair to new condition and appear to be operating correctly. The lavatories, urinals, and water closets are wall mounted. Cost is for water closet replacement.	Services	Plumbing	Domestic Water Distribution	Plumbing Fixtures	4-Future	Good	9	\$2,000	Each	\$18,000
5731	H.C. Storm School	1124 - Plumbing, Plumbing Fixtures		Toilet	2014	Sent to Maintenance	Nurse toilet room Per 2014 H/LS Report - There are an adequate number of fixtures in the building to meet the requirements of the Illinois Plumbing Code. The plumbing fixtures range from fair to new condition and appear to be operating correctly. The lavatories, urinals, and water closets are wall mounted. Cost is for water closet replacement.	Services	Plumbing	Domestic Water Distribution	Plumbing Fixtures	4-Future	Good	1	\$2,000	Each	\$2,000
5733	H.C. Storm School	1128 - Fixed Equipment, Casework		Office	2020	Sent to Maintenance	Overall good condition. Nurse office	Equipment and Furnishings	Furnishings	Fixed Furnishings	Casework	4-Future	Good	20	\$800	Linear Foot	\$16,000

Assessment ID	Campus	Linked Bldg System	Addition	Room	Assessment Year	Assessment Status	Description	Building System L1	Building System L2	Building System L3	Building System L4	Priority	Facility Condition	Quantity	Unit Cost	Unit Of Measure	Estimated Cost	
5736	H.C. Storm School	1139 - Roof Windows and Skylights		Corridor/Collaboration	2020	Sent to Maintenance	D-Wing Collab Space Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Shell	Exterior Horizontal Enclosures	Horizontal Openings	Roof Windows and Skylights	4-Future	Good	0	\$200	Square Foot	\$0	
5737	H.C. Storm School	1139 - Roof Windows and Skylights		Entry/Lobby	2020	Sent to Maintenance		Shell	Exterior Horizontal Enclosures	Horizontal Openings	Roof Windows and Skylights	4-Future	Good	50	\$200	Square Foot	\$10,000	
6213	H.C. Storm School	1118 - HVAC, Cooling-Chiller			2020	Sent to Maintenance	Per Capital Projects Plan - chiller scheduled for replacement in 2031.	Services	Heating, Ventilation, and Air Conditioning (HVAC)	Cooling Systems	Central Cooling	4-Future	Good	1	\$175,000	Each	\$175,000	
6214	H.C. Storm School	1114 - HVAC, Ventilation-AHU			2020	Sent to Maintenance	Per Capital Projects Plan - 2 AHUs scheduled for replacement in 2033.	Services	Heating, Ventilation, and Air Conditioning (HVAC)	Ventilation	Supply Air	4-Future	Good	2	\$60,000	Each	\$120,000	
7942	H.C. Storm School	10169 - Interior Wall Finish, Paint	West Classrooms	Office	2020	Sent to Maintenance	SF indicated for room area to receive paint. LRC Office 18	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	4-Future	Good	236	\$2	Square Foot	\$531	
7945	H.C. Storm School	10170 - Interior Wall Finish, Paint		Office	2020	Sent to Maintenance	SF indicated for room area to receive paint. General Office, Principal's Office	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	4-Future	Good	402	\$2	Square Foot	\$905	
7946	H.C. Storm School	10169 - Interior Wall Finish, Paint		Staff	2020	Sent to Maintenance	SF indicated for room area to receive paint. Teacher's Lounge 504	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	4-Future	Good	419	\$2	Square Foot	\$943	
7955	H.C. Storm School	10170 - Interior Wall Finish, Paint		Conference	2020	Sent to Maintenance	SF indicated for room area to receive paint. D-Conference 4, 3, 2; 3,148 SF Note the total estimated cost is not calculated - refer to items 3532, 3541, and 5670 for whole area renovation costs.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	4-Future	Good	0	\$2	Square Foot	\$0	
7958	H.C. Storm School	10169 - Interior Wall Finish, Paint		Gym	2020	Sent to Maintenance	SF indicated for room area to receive paint.	Interiors	Interior Finishes	Wall Finishes	Wall Painting and Coating	4-Future	Good	6136	\$1	Square Foot	\$5,522	
																	Total Cost	\$8,260,949
																	Priority 1	\$4,152,898
																	Priority 2	\$2,999,169